


INSTRUCTION SHEET


SM - Surface Mounted

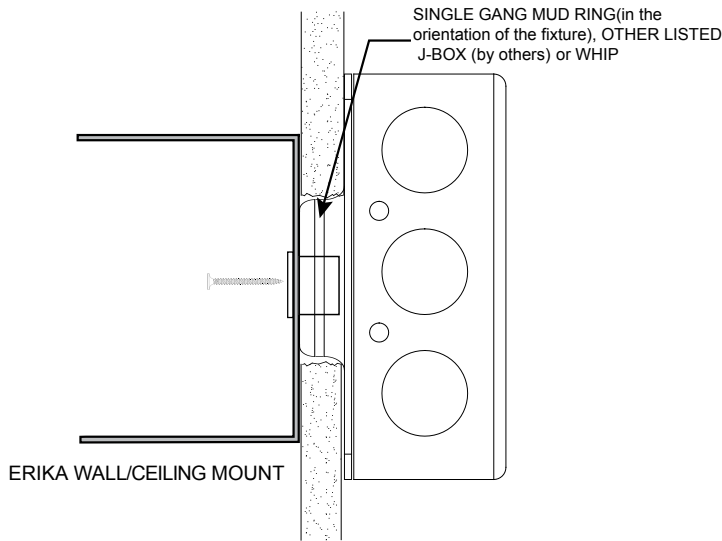

1. Install J-Box (by others) with single gang mud ring horizontally mounted, or other suitable UL approved J-Box. Alternately a whip with a UL approved conduit snap-in flex connector can be stubbed out of the mounting surface, provided by others.
2. Remove lens, lamp and internal liner or LED tray.
3. Determine fixture location on wall and note/mark the center of the J-Box/whip on the fixture.
4. Drill appropriate size hole for wire feed through fixture - DO NOT DRILL INTO POWER SUPPLY - Relocate driver if necessary - insert bushing (by others).
5. Drill mounting support holes 7" in from corner - support method to be determined by contractor.
6. Complete wire make-up.
7. Securely mount fixture to surface.
8. Reinstall lamp and internal liner or LED tray
9. Install lens.

Continuous Run Info:

1. Install starter fixture following 1-6 above.
2. Remove lens and liner of adjacent fixture
3. Install next fixture, slide open end of fixture into starter fixture's continuous run pinch brackets and alignment splines or guide pins.
4. Secure with supplied washers and nuts on pinch bracket (Note: the internal "L" bracket should be set back 1/16" from the edge of the fixture – they can be adjusted if necessary)
5. Tighten set screws on the alignment splines if used.
6. Ensure fixtures are level and securely tightened to each other to avoid potential light leak between housing.
7. Thru wire with appropriate gauge wire if integral ballast/driver. All pre-installed thru wire QCS quick connects (if applicable) are rated for max. 9 amps. Do not exceed this rating.
8. Continue installation for all other fixtures in the row, by repeating 2-7.
9. Replace all liners, install lamps (if fluorescent), install all lenses or louvers. Ensure all connections are secure.

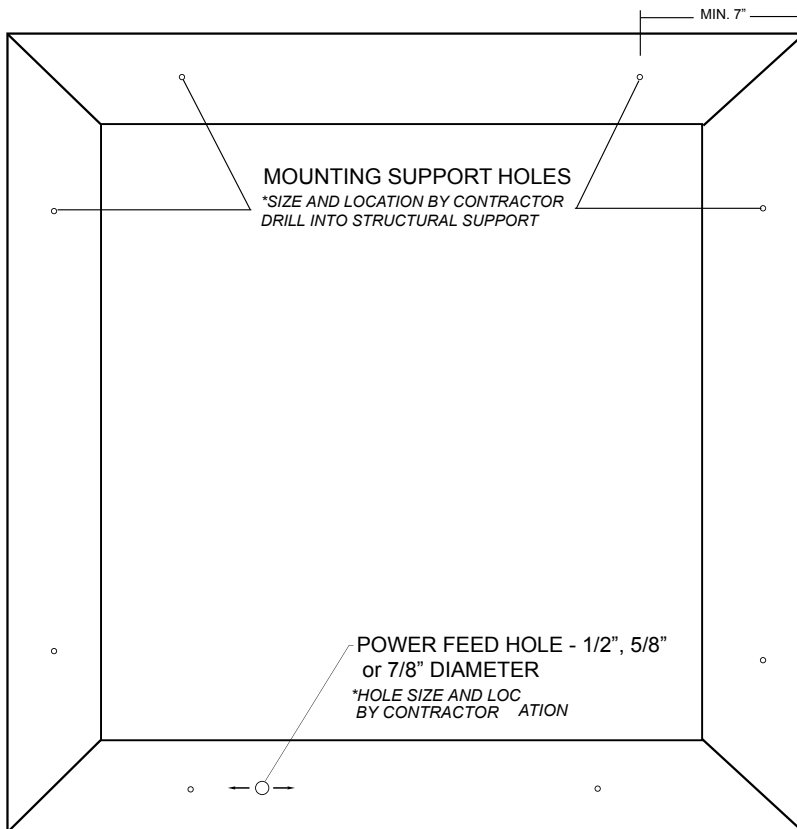

Note: To be installed by a qualified electrician per N.E.C. and all local codes.

820-00077

V-0115